


6" CHART RECORDERS

Supco CR4 & SL4

The CR4 six (6) inch universal chart recorder offers the ultimate in flexibility. Choose one of 5 sensors for your application, connect it to the CR4, make desired speed selection and start recording. When your application calls for a different sensor, just change probes for the same recorder.

If you prefer to log data and download to a computer for analysis, the SL4 Service Logger has the same great flexibility as the CR4. The same probes can be used with the SL4.

- Automatic probe recognition
- Front panel touch pad
- Real time data view
- Battery backup (CR4)
- Field replaceable probes
- Field calibration of probes
- Independent channel Alarms (CR4)
- PC software included (SL4) (Windows 95 & 98 compatible only)

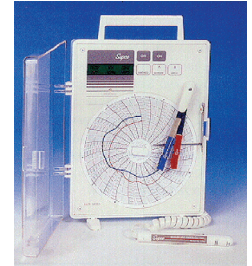

5 Interchangeable Probes

KTH Temperature and Humidity Probe

KTT Dual Temperature Probes

KTP Temperature and Pressure Probes

KPP Dual Pressure Probes

KTE Temperature/Event Probes

SPECIFICATIONS	CR4	SL4
Chart Diameter	6 inches	-
Recording Time	-	5 hrs. to 40 days
Chart Rotation Mode	Continuous or single turn	-
Memory	-	16 K non-volatile
Chart Rotation Speed	1.5, 3, 6, 12 & 24 hrs, 7 & 31 days	-
Printer Interface	-	Parallel (centronics compatibe)
Chart Speed Accuracy	±1%	-
Charts	60 assorted included	-
Display	LCD (2 line)	LCD (2 line)
Temperature Alarm Range	-20°F to 120°F (-30°C to 50°C)	-
Relative Humidity Alarm Range	0 to 100%	-
Pressure Alarm Range	0 to 500 PSI (0 to 35 Bar)	-
Alarm Delay	NO DELAY, 10 mins., 30 mins., 1 hr. or 2 hrs.	-
Remote Alarm Connection	NO, 48 VAC/DC, 0.1A resistive load	-
Operating Temperature	32°F to 120°F (0°C to 50°C)	32°F to 150°F (0°C to 65°C)

Supco CR87 Series

The CR87 six(6) inch chart recorder series set the standard for reliable and rugged trend reporting. Choose the right model for your application.

- Micro-controller design
- Large LED Display
- Front Panel controls
- Single or continuous chart rotation
- Choose from 120V or 220V models
- Battery Backup
- 12 V operation
- Comes with 2 cartridge pens & 60 (6" dia.) assorted charts
- Convenient folding handle
- Snap-on support legs
- Free standing or wall mount



CR87B - Temperature Recorder

- Temperature range: -40°F to 120°F (-40°C to 50°C)
- Remote readings from up to 100ft. (optional sensor wire p/n CABLE10T)
- Programmable speed and temperature ranges

CR87HT - High Temperature Recorder

- Temperature range: 0°F to 1000°F (0°C to 500°C)
- Remote readings from up to 2000 ft.
- Programmable speed and temperature ranges

CR87V - Voltage Recorder

- Choose voltage or current measurements
- Voltage Range 0 5V, 0-10 mV
- Current Range 0 20 mA, 4-20 mA
- Programmable speed and voltage or current ranges

CR87P - Pressure Recorder

- Pressure Range 0 to 500 PSI (0 to 35 BAR)
- Stainless steel 17-4 Pressure sensor with port ¼ NPT
- 2500 PSI burst pressure
- Rated for any gas or fluid compatible with 17-4 stainless steel
- Programmable speed and pressure ranges

CR87E - Event Recorder

- Programmable speed and event information
- Displays length of event, time between events or total events
- Complete with probes for voltage, sound and Light

SPECIFICATIONS	CR87B	CR87HT	CR87P	CR87V
Chart Speed Selectable	6 hours, 24 hours, 7 days, 31 days			
Chart Rotation Mode	Single turn or continuous			
Chart Speed Accuracy	±1%			
Display	3 digit LED 0.5"			
Recording Pen	Ink type			